

CENTURY ARMS WASR-2 ROMANIAN SIDE FOLDER 5.45X39MM, \$600

GUN TESTS GRADE: D

All sorts of trouble plagued the Romanian-made gun. Rounds caught on the ramp, locking the action open. The charging handle got stuck, and sharp edges gouged our fingers. The gun also began doubling, a malfunction that we're not going to mess around with.




SPECIFICATIONS

Overall Length, Stock Folded 27.1 in.
Overall Length, Stock Extended 35.75 in.
Barrel Length/Twist 16 in./1:8 in., 4 grooves
Sight Radius (Max) 15.2 in.
Overall Height w/30-rd. Magazine 10.0 in.
Length of Pull, Stock Extended 14.2 in.
Maximum Thickness, Stock Folded 3.7 in.
Maximum Thickness, Stock Extended 3.7 in.
Weight Unloaded 7.2 lbs.

Weight w/Loaded 30-Rd. Mag 8.25 lbs.
Magazines 1 Polymer 30-rd.
Action Type Gas-Operated Semi-Automatic
Receiver Stamped Parkerized Steel
Barrel Parkerized Steel
Stock Tapco Folder
Handguards Wood
Trigger Pull Weight 3.5 lbs. (Tapco G2)
Safety Side-Mounted Lever

Front Sight Elevation, Adjustable Post
Windage, Driftable
Rear Sight Elevation Adjustable
Flash Hider None
Warranty 1 Year
Telephone (800) 527-1252
Website www.CenturyArms.com
Assembled In USA
Made In Romania

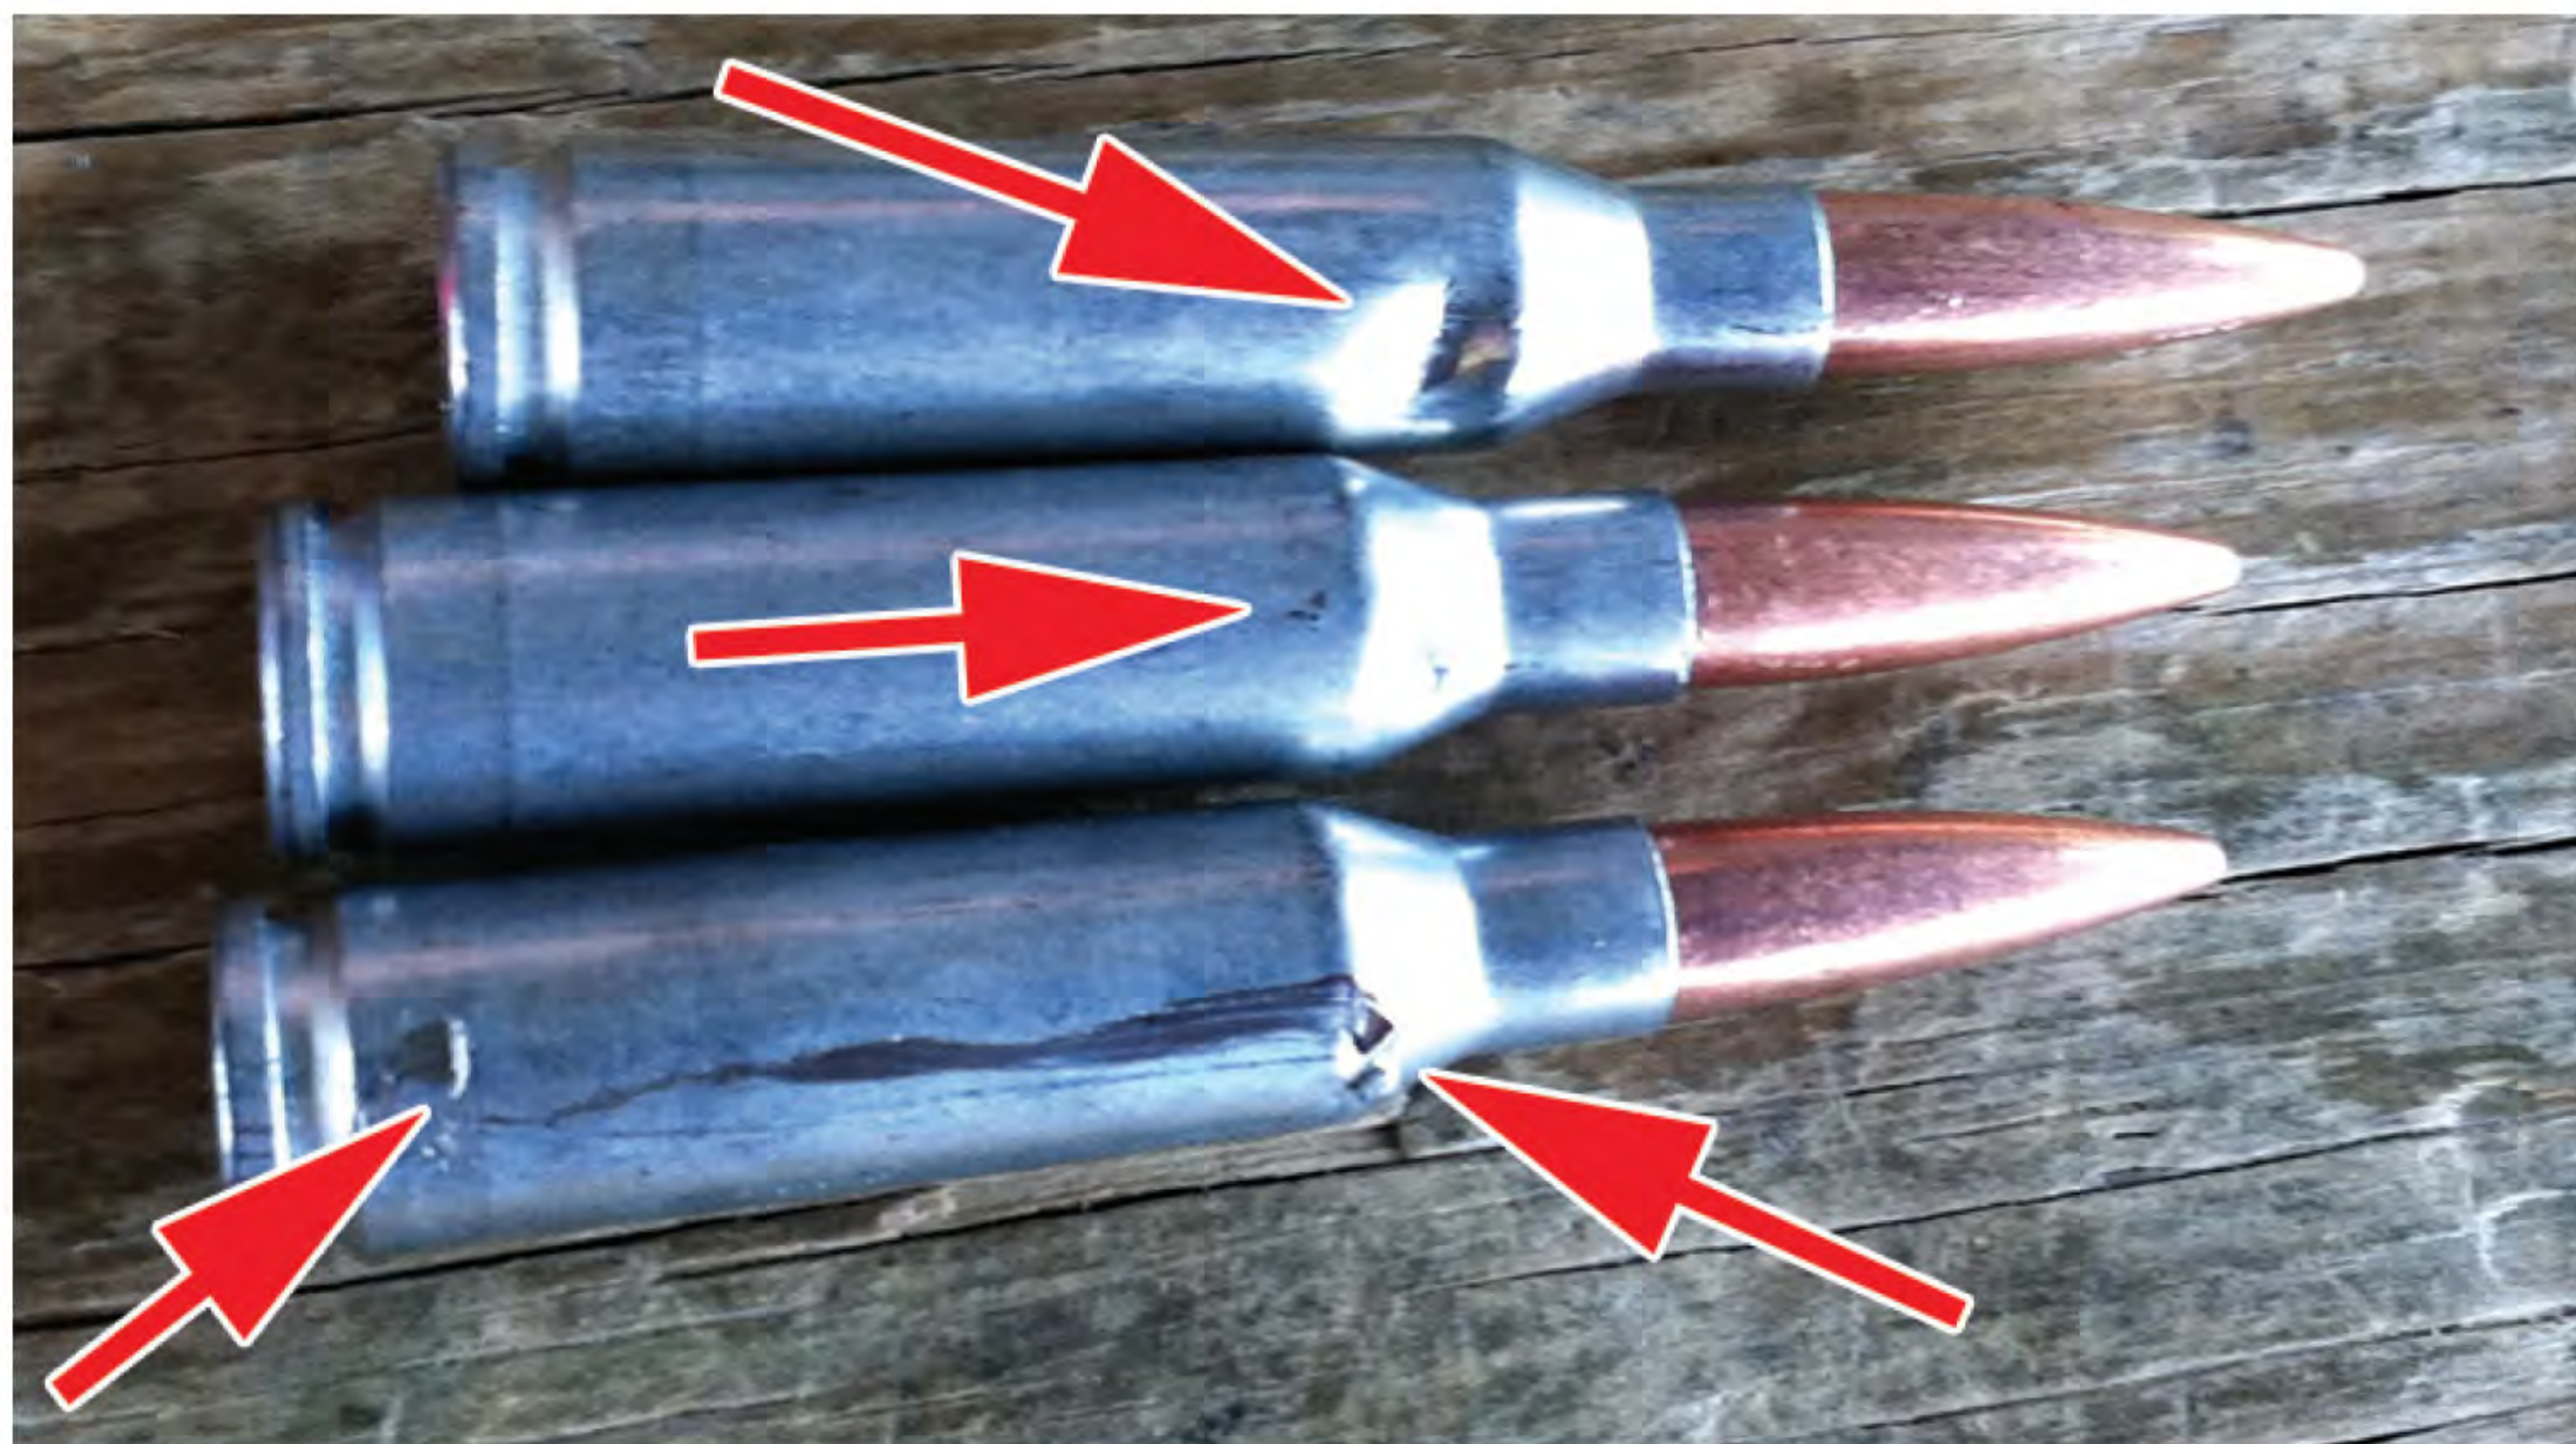

These rounds came out of the Century Arms pretty dinged up. The arrows point to a variety of insults the action delivered to the cases.

In normal use, we broke the hinge on the Tapco folding stock. Here's the exposed spring showing through the sheared bracket.



One of the tenets of the AK platform is that they'll run dirty, cold, untended, and generally in crappy condition. Our Century AK was an aberration, then, because we had feeding problems with all of our ammo/magazine combinations and it doubled.